

Installation Instructions & Use Recommendations

FMS Accessories – Radio Power Plug Divider – Code A

These instructions must be read carefully and thoroughly **before** beginning work. FMS Solutions, LLC accepts no liability for damage caused by failure to observe the installation instructions or use recommendations.

Installation of this accessory does not change the factory specified load limits for the motorcycle.

FMS Solutions, LLC has just been made aware that a **part similar to the FMS Accessory Radio Power Plug Divider – Code A** may not be to specification. We have found that some recently produced BMW Y harnesses previously sold by BMW dealers under PN 71 60 2 452 880 had pins and sockets that may be insufficiently crimped. You can identify the installed part by the solid red wire (rather than red w/black stripe), copper wire strands (rather than silver tinned strands) and larger PVC. The attached photo shows the BMW version and the FMS Accessory version. Dealers should check their stock as well as keep an eye open for these as BMW sold many of these, though the only complaints to-date have been for parts produced for BMW in 2020. If you see the solid red wire version, you may wish to give them a “tug” test to see if they come apart (make sure you have a replacement one available if they do) or extract the terminal from the housing and recrimp it to ensure it is tight.

Note that any previously sold / installed BMW Parts that are found to be defective would be covered by the respective BMW Limited Warranty on motorcycles and parts and not by FMS Accessories. Since BMW no longer sells this part, a replacement can be ordered from FMS Accessories and processed through BMW as a sublet claim. Only parts sold by FMS Accessories are covered by the FMS Accessories limited warranty.

